

First Fleet Maintenance LTD

140 MacLennan Crescent
Fort McMurray AB T9H 4E8
info@firstfleet.ca
www.firstfleet.ca
GST/HST Registration No.: 833031859RT0001



INVOICE

BILL TO
Laurence
Heavy Wrench Mechanical
6 Ireland
Guelph Ontario N1E7C2

INVOICE 18713
DATE 30/03/2021
TERMS Net 30
DUE DATE 29/04/2021

DESCRIPTION	QTY	RATE	AMOUNT
UNIT JT 01 2012 DODGE RAM 5500 6.7L 3C7WDNBL1CG164184 326,666 KMS 14,221 HOURS UNIT CAME IN FOR A LIST OF ITEMS: * STEERING JAMMING UP WHEN HOT * WASHER PUMP AND GROMMET * OIL CHANGE * CHECK ALL FLUIDS * UNDERCARRIAGE WASH * GREASE UNIT * NOISE IN FRONT END * WHEEL STUDS MISSING LEFT REAR * SWAP OUT RIGHT REAR OUTER TIRE (CUSTOMER ALREADY DONE) * VIBRATION AT 80 KM/HR * COMPLEMENTARY INTERIOR DETAIL (** VERY IMPORTANT TO NO MOVE ANYTHING ** DO THE BEST WE CAN WITHOUT MOVING CUSTOMERS ITEMS) THERE ARE A LOT OF ITEMS IN UNIT. BROUGHT UNIT IN AND PERFORM GENERAL INSPECTION BEFORE TAKING FOR UNDERCARRIAGE. UPON INSPECTION FOUND THE FOLLOWING ITEMS THAT REQUIRE ATTENTION: * LOTS OF MUD IN WHEELS AND AROUND DRIVELINE, MAY STILL NEED TO CHIP AWAY ONCE UNDERCARRIAGE IS COMPLETE * FRONT CRANK SEAL IS LEAKING (CUSTOMER DECLINED) * CVI EXPIRED (CUSTOMER DECLINED) * POWER WINDOWS INOP (CUSTOMER DECLINED) * BOTH REAR LEAF PACKS HAVE BROKEN SPRINGS (CUSTOMER DECLINED) * STEERING SHOCK LEAKING * STEERING VERY STIFF * FRONT DRIVESHAFT SLIP YOKE WORN AND U-JOINT BROKEN * FRONT AXLE U-JOINTS LOOSE AND HAVE HEAVY ORANGE RUST			

* LEFT FRONT AXLE SEAL LEAKING
 * LEFT SIDE ROOF MARKER LIGHT OUT

00	LABOUR	1	175.00	175.00
	TAKE UNIT FOR UNDERCARRIAGE WASH			
30	UNDERCARRIAGE WASH (APPROX COST)	1	350.00	350.00
	SERVICED UNIT, CHANGED OIL AND OIL FILTER AS REQUIRED			
00	LABOUR	0.50	175.00	87.50
LF3972	OIL FILTER	1	10.58	10.58
30088-1000L	OIL, 5W40 SYN CK4 BULK	11.50	10.46	120.29
	CHECKED AIR FILTER AND IT'S EXTREMELY DIRTY, REMOVED AND REPLACED AIR FITLER AS REQUIRED			
00	LABOUR	0.25	175.00	43.75
AF27684	AIR FILTER	1	39.99	39.99
	CHECKED ALL FLUID LEVELS AND EVERYTHING IS GOOD. REAR DIFF, TRANSFER CASE AND TRANSMISSION.			
00	LABOUR	0.75	175.00	131.25
	REPLACED BURNT OUT BULB IN LEFT SIDE CAB ROOF MARKER			
194	BULB, MIN	1	1.19	1.19
	CLEAN UP FROM WHEELS			
00	LABOUR	0.75	175.00	131.25
	REMOVE AND REPLACE WASHER PUMP AND GROMMET. ONE NOZZLE WAS PLUGGED, REPLACED AS REQUIRED.			
00	LABOUR	1	175.00	175.00
68081805AB	PUMP	1	67.92	67.92
5152030AA	GROMMET	1	28.51	28.51
4805742AC	NOZZLE	1	38.38	38.38
	REPLACE REAR WHEEL STUDS AND NUTS THAT ARE BROKEN			
00	LABOUR	0.75	175.00	131.25
6509420AA	STUD	2	39.78	79.56
6509424AA	NUT	2	28.51	57.02
	REMOVE AND REPLACE FRONT DRIVE SHAFT AS REQUIRED. WAS UNABLE TO HAVE PUMP REBUILT, DEALER WAS 1-2 WEEKS AWAY. SOUCED AFTERMARKET AS REQUIRED.			
00	LABOUR	1	175.00	175.00
10	DRIVESHAFT	1	1,021.68	1,021.68
	REMOVE AND REPLACE FRONT AXLE U-JOINTS AND AXLE SEALS, SUGGEST DOING THIS BEOFRE CONTIUNING TO DIAGNOSE STEERING ISSUES. HAD TO CUT OUT U-JOINTS AS THEY WERE SEIZED AND HAD TO REPLAXE FRONT AXLE SHAFT COLLARS			
00	LABOUR	6	175.00	1,050.00

68034436AB	U-JOINT	2	189.23	378.46
19756A	AXLE SEALS	2	45.39	90.78
68247692AA	COLLAR	2	113.51	227.02
	REMOVE AND REPLACE LEAKING STEERING SHOCK AS REQUIRED.			
00	LABOUR	0.50	175.00	87.50
MONSC2968	STEERING SHOCK	1	91.95	91.95
	RE-CHECK STIFF STEERING AFTER REASSEMBLED AND IT'S STILL PRESENT, CAN FEEL PAULSE IN STEERING WHEEL AND BRAKE PEDAL, GOES AWAY AND STEERING GETS EAIER WHEN RPM INCREASED. UNIT WILL REQUIRE A NEW POWER STEERING PUMP. CUSTOMER AND MAYSELF SPOKE TO CLIFF AT LEGACY ON FRIDAY AND WAS ASSURSED FIRST FLEET COULD PURCHASE THE PART AND MAKE THE WARRANTY CLAIM. INSTALLED POWER STEERING PUMP AS REQUIRED, TEST DROVE UNIT AND EVERYTHING IS WORKING AS IT SHOULD.			
00	LABOUR	1.50	175.00	262.50
200	FREIGHT	1	85.00	85.00
20	SHOP SUPPLIES	1	220.50	220.50
10	MISC PARTS	1	0.20	0.20

All Wheels Must be Torqued at 100 Km's by a Qualified Technician

SUBTOTAL	5,359.03
GST @ 5%	267.97
TOTAL	5,627.00
PAYMENT	5,627.00
BALANCE DUE	\$0.00

PAID

TAX SUMMARY

	RATE	TAX	NET
GST @ 5%		267.97	5,359.03