

# Vehicle Inspection Report

Date: Sep 20 2022

Page: 1/3

2005 NISSAN-DATSUN TRUCK X-TRAIL 4-2488 2.5L DOHC

Odometer In: 260877

VIN: JN8BT08V95W111350

Odometer Out: 260883

Plate: 78965

## \*\*DASH LIGHTS\*\*

Check Engine Light

☐ ☒ ☐ ☐ On

## Comments

Our scanner does not recognize this model.my quick scanner shows a pending p0420 cat convertor code.could be cat is on way out, or engine running izzue.expect will have to see dealer for proper diag as our scanner does not communicate or recognize car

**Suggest:** Technician's recommendation based on substantial and informed experience

ABS Light

☐ ☒ ☐ ☐ N/A ☐ On

can not scan, no light on

**Suggest:** Technician's recommendation based on substantial and informed experience

TPMS Light

☐ ☐ ☐ ☒ N/A ☐ On

Oil Light Reset

☐ ☒ ☐ ☐ N/A ☐ Reset

no light on, but oil change is 13000 kms over due by sticker

**Suggest:** Technician's recommendation based on substantial and informed experience

Other Lights

☐ ☒ ☐ ☒ On

washer fluid light on, will be topped with oil change

**Suggest:** Technician's recommendation based on substantial and informed experience

## \*\*LIGHTS/ACCESSORIES\*\*

## Comments

Wiper Blades

☒ ☐ ☐

rear wiper arm is siezed

Washer Pump

☒ ☐ ☐

Horn

☒ ☐ ☐

note. it outer door handle broken 1.0 hr

Headlights

☒ ☐ ☐

Fog Lights

☐ ☐ ☒ ☐ N/A

both broken or missing. expect 1.5 hr to replace both assys

**Required:** Part is missing

Turn Signal Lights

☒ ☐ ☐

Parking Lights

☐ ☐ ☒

rt ft and both rr side markers outboth license lights out.8 for the bulbs

**Required:** Part no longer performs intended function

Brake Lights

☒ ☐ ☐

Reverse Lights

☒ ☐ ☐

Plate Light

☐ ☐ ☒

**Required:** Part no longer performs intended function

## \*\*UNDER HOOD\*\*

## Comments

Battery Test

☒ ☐ ☐ 1. Rated CCA 675 2. Actual CCA 12.59v @675cca ☐ 3. N/A

Reason Codes

Required:

A - Part no longer performs intended function

B - Part does not meet a design specification (regardless of performance)

C - Part is missing

Suggested:

1 - Part is close to end of useful life (just above discard specifications, or weak, failure likely to occur soon, etc.)

2 - Address a customer need, convenience, or request (to stiffen ride, enhance performance, eliminate noise, etc.)

3 - To comply with maintenance recommended by the vehicle Original Equipment Manufacturer

4 - Technician's recommendation based on substantial and informed experience



# Vehicle Inspection Report

Date: Sep 20 2022

Page: 2/3

20064200076529

2005 NISSAN-DATSUN TRUCK X-TRAIL 4-2488 2.5L DOHC

Odometer In: 260877

VIN: JN8BT08V95W111350

Odometer Out: 260883

Plate: 78965

Battery Terminals

☐ ☒ ☐

☐ Not Accessible

battery terminals are green and corroded, rec battery service (.4hr)

**Suggest:** Technician's recommendation based on substantial and informed experience

Belt(s)

☒ ☐ ☐

Tensioner(s)

☒ ☐ ☐

☐ N/A

Coolant Hoses

☒ ☐ ☐

Air Filter

☐ ☐ ☒

**Required:** Part no longer performs intended function

black and plugged, over due

Cabin Air Filter

☐ ☐ ☐

☒ N/A

## \*\*UNDER HOOD FLUIDS\*\*

Coolant

☐ ☒ ☐

1. pH

2. Freeze Point

**Suggest:** Technician's recommendation based on substantial and informed experience

## Comments

green coolant. due every 3 yr/100k.when done last?level ok in rad, but low in resirviorrec drain and refill - 1.0hr

Oil Level on Arrival

☒ ☐ ☐

☐ Low

oil level ok, but very dark, over due by sticker

Windshield Washer

☒ ☐ ☐

topped

Power Steering

☐ ☒ ☐

☐ N/A

dark, due for service every 3yr/100kmswhen done last? recommend service 1.0 hr

**Suggest:** Technician's recommendation based on substantial and informed experience

Transmission

☐ ☒ ☐

☐ N/A

getting dark, level okdue 5yr/80kmsrec trans drain and fill - 1.0 hralso when was rear diff servive done last, every 3yr/60 kmsrec diff drain & fill - .5hr

**Suggest:** Technician's recommendation based on substantial and informed experience

Brake(visual)

☐ ☒ ☐

black, over due3yr/100kmsrec brake fluid service .8 hr

**Suggest:** Technician's recommendation based on substantial and informed experience

Clutch(visual)

☐ ☐ ☐

☒ N/A

## \*\*UNDER VEHICLE\*\*

Fluid Leaks

☐ ☐ ☒

## Comments

oil seepage on left upper side of engine, minor-monitoroil leak on rt rear back side of engine. not on ex yetexpect engine oil cooler assembly, reseal and shampoo. may need cooler replaced.rec start with shamppo, and recheck ito confirm leakshampoo .6

**Required:** Part does not meet a design specification (regardless of performance)

Fuel Filter

☐ ☐ ☐

☒ N/A

## Reason Codes

Required:

A - Part no longer performs intended function

B - Part does not meet a design specification (regardless of performance)

C - Part is missing

Suggested:

1 - Part is close to end of useful life (just above discard specifications, or weak, failure likely to occur soon, etc.)

2 - Address a customer need, convenience, or request (to stiffen ride, enhance performance, eliminate noise. etc.)

3 - To comply with maintenance recommended by the vehicle Original Equipment Manufacturer

4 - Technician's recommendation based on substantial and informed experience



# Vehicle Inspection Report

Date: Sep 20 2022

Page: 3/

2005 NISSAN-DATSUN TRUCK X-TRAIL 4-2488 2.5L DOHC

Odometer In: 260877

Odometer Out: 260883

VIN: JN8BT08V95W111350

Plate: 78965

CV Boots

☐ ☒ ☐

☐ N/A

**Suggest:** Technician's recommendation based on substantial and informed experience

left out cv boot has been seeping grease for some time boot is starting to crack, rec shaft assy - 1.8 hr

Brake/Fuel Lines

☒ ☐ ☐

Chassis Lube

☐ ☐ ☐

☒ N/A

Seasonal Changeover

☒ ☐ ☐

Alignment Check

☒ ☐ ☐

Rust Protection

☐ ☐ ☒

☐ N/A

exhaust, shield around cat and front pipes and are rotting out. rattly. could put clamp around pipe shield to reduce rattling. center exhaust pipe is rotted out/broken at muffler. needs center pipe gskts & bolt kits for front and rr of 1.0 hr if no broken

**Required:** Part no longer performs intended function

## \*\*TIRES\*\*

Front Driver

☐ ☒ ☐

/32nds  
4

PSI/Arrival

PSI/OEM Specs

**Suggest:** Technician's recommendation based on substantial and informed experience

## Comments

front tires are getting low over due for rotation will rotate when tires are off to check brakes expect tires with in a year 215-65r16

Front Passenger

☒ ☐ ☐

/32nds  
4

PSI/Arrival

PSI/OEM Specs

Rear Driver

☒ ☐ ☐

/32nds  
6

PSI/Arrival

PSI/OEM Specs

Rear Passenger

☒ ☐ ☐

/32nds  
6

PSI/Arrival

PSI/OEM Specs

3 nuts on rt rr wrong. should have acorn nuts

## \*\*BRAKE INSPECTION\*\*

NOTE: Brake inspection will only be completed when the tires are removed.

☐ N/A

Left Front Brake Pads

☐ ☐ ☒

☐ 1.OK(+6 mm) ☐ 2.Suggested(4-5 mm) ☒ 3.Required(-3 mm)

*BOTH COMPLETED*

**Required:** Part no longer performs intended function

notes for suspension both front outer tierods dangerously loose tierods 1.5 hr + align 1.2 hr strut boots torn, struts still feel ok. do boots w/ strut assy expect 2.0 hr ft & 2.0 hr rec dealing w/ ex then reassess wheel bearing

Right Front Brake Pads

☐ ☐ ☒

☐ 1.OK(+6 mm) ☐ 2.Suggested(4-5 mm) ☒ 3.Required(-3 mm)

due for front brakes 3mm

**Required:** Part no longer performs intended function

Left Rear Brake Pads

☒ ☐ ☐

☒ 1.OK(+6 mm) ☐ 2.Suggested(4-5 mm) ☐ 3.Required(-3 mm)

Right Rear Brake Pads

☒ ☐ ☐

☒ 1.OK(+6 mm) ☒ 2.Suggested(4-5 mm) ☐ 3.Required(-3 mm)

rear stab bar bushing loose and noisy. expect 1.0 hr for bushings

Reason Codes

Required:

- 4 - Part no longer performs intended function
- 3 - Part does not meet a design specification (regardless of performance)
- 2 - Part is missing

Suggested:

- 1 - Part is close to end of useful life (just above discard specifications, or weak, failure likely to occur soon, etc.)
- 2 - Address a customer need, convenience, or request (to stiffen ride, enhance performance, eliminate noise, etc.)
- 3 - To comply with maintenance recommended by the vehicle Original Equipment Manufacturer
- 4 - Technician's recommendation based on substantial and informed experience