



- [Close Window](#)
- [Print This Page](#)
- [Expand All](#) | [Collapse All](#)

Hydrovacs B Service - 127960 - WO-4399

Tracking Number	W-2E5-8E2-0E9C	EAM Service Location	CIS Interco Only - P&V Shop
Name	Hydrovacs B Service - 127960 - WO-4399	Assigned to Mechanic	Justin Scott Hapgood
Work Order ID	WO-4399	Parts Person	Shannah Danielle Humby
Description	700 Hour Service	Project	FMM SYNC PV 2020 - BMCS JV - R&M - In shop
IsCompleted	<input checked="" type="checkbox"/>	Equipment	Hydro Vac Tridrive
Past Due	<input type="checkbox"/>	Equipment PO	PO-0018829
		Equipment Unit Number	127960
Planned Start Date		Record Type	Preventative Maintenance
Planned Finish Date		Source PMS	
Due Date		Priority	
Actual Start Date	3/5/2021 5:46 PM	Status	In Progress
Actual Finish Date	3/16/2021 12:19 PM		
Approver	Brandy Marie Hepditch	Total Duration	10 days 17 hours 32.3 mins
Hours	19,091.00	Work Order Duration	10.73
Mileage	103,320	WO Labor Cost	\$6,469.65
Next service due (hours)		WO Items Cost	\$2,070.80
AX Service Order ID	CIS1066176	WO 3rd Party Cost	\$825.96
ItemCount	49	Total WO Cost	\$9,366.41

General Notes

Note

System Information

Owner	Liquid Frameworks	Last Modified By	Mike Curtis, 3/10/2023 10:06 AM
Created By	Brandy Hepditch, 2/16/2021 12:15 PM	IsTemplate	<input type="checkbox"/>
		Uncompleted WO Tasks	2

Work Order Tasks

WT-29265

Task Category	Transmission
Title	
Description	Justin H 6/3/21

	-I had performed a clutch adjustment on clutch
Check Issue	<input type="checkbox"/>
Completed On	3/6/2021 9:45 AM
Action Taken	
Expected Time to Complete	4.00
Time to Complete	0.50

WT-29266

Task Category	Function Test
Title	Function Test
Description	Justin H 6/3/21 -I had performed a function test on the system for the burner and the vacuum -Found multiple ball valves that failed, leaking and bypassing
Check Issue	<input type="checkbox"/>
Completed On	3/6/2021 2:50 PM
Action Taken	
Expected Time to Complete	0.50
Time to Complete	1.33

WT-29267

Task Category	Chassis
Title	Truck B Service and Inspection Service Engine (Oil/Filter) Check Fluid Levels (Coolant/Power steering/Etc.) Inspect Exhaust Inspect Heater/Defroster/Cooling System Inspect Body/Bumpers/Mud Flaps Inspect Airlines/Air tank/Air Compressor Inspect Fifth Wheel/Release lever Inspect Differential (Check Fluid Levels)
Description	Inspect Suspension Inspect Springs (Front/Back) Inspection Transmission (Check Fluid Levels) Inspect Clutch and Driveline Inspect Brakes/Park Brakes Inspect Tires/Rims/Wheel Nuts Inspect Windshield /Windows Inspection Battery/Lights/Reflective Tape Inspect Safety Equipment (Fire Ext, First Aid Kit) Ensure Correct Paperwork is in Unit
Check Issue	<input type="checkbox"/>
Completed On	
Action Taken	
Expected Time to Complete	4.00
Time to Complete	0.00

WT-29268

Task Category	General Inspection
Title	Vacuum System B Service and Inspection
Description	Inspect Deflector Plate Inspect Turret Condition Inspect Boom Hose and Fittings Inspect Float Ball Assembly Inspect Rear Door Seal Inspect Tank Level Gages Inspect Valve Conditions (Ball/Gate) Inspect Dust Caps on Camlocks Inspect Heat Trace Inspect Tank Mounting Inspect Diesel Flush Ball Valve Operation

Inspect Safety Labels
 Inspect Blower Oil
 Inspect Hydraulic Oil and Filters
 Inspect Drop Box Oils, Seals and Breather
 Inspect Burner Filters
 Inspect CAT Pump Oil
 Inspect Blower Filter
 Inspect Water Strainer/Filter
 Inspect Boom Remote Operation
 Inspect Doghouse Heaters
 Inspect Seal Nuts on 90L Hydraulic Pump
 Inspect Inverter Wiring
 Inspect Glycol Tank
 Inspect Hydraulic Cooler Fans

Check Issue ☐

Completed On

Action Taken

Expected Time to Complete **3.00**

Time to Complete **0.00**

WT-29936

Task Category **Transmission**

Title **Trans cooler**

Justin H 3/3/21

Description
 -Trans cooler was removed from truck cause of failure, needed new cooler put on
 -I had installed the trans cooler on top of the transmission
 -filled up transmission with ATF, Did not flush because truck was lifted and I did not want to start

Check Issue ☐

Completed On **3/3/2021 1:00 PM**

Action Taken

Expected Time to Complete

Time to Complete **2.83**

WT-29937

Task Category **Cooling System**

Title **Cooling system leaking**

Justin H 3/3/21

Description
 -Noted on defect list that there was multiple coolant leaks
 -Bottom of radiator hose was leaking from silicone coupler
 -I had removed and replaced clamp that was holding coupler to pipe, I had also inspected pipe and coupler for wear and they looked to be in fair condition
 -System was pressure tested to check for leaks was left over night
 -Also leaking from bottom of radiator downpipe threads (noted on defect list) I had replaced the ball valve with new one because old one had handle broken off of it

Check Issue ☐

Completed On **3/3/2021 2:00 PM**

Action Taken

Expected Time to Complete

Time to Complete **2.00**

WT-29938

Task Category **Hydraulic System**

Title **Hydraulic gauge cracked**

Justin H 3/3/21

Description
 -Noted on defect list that temp gauge was cracked
 -I had replaced the temp gauge on the side of hydraulic tank
 -I had also replaced the two hydraulic filters because out of date and one was leaking

Check Issue ☐

Completed On **3/3/2021 2:50 PM**

Action Taken
Expected Time to Complete
Time to Complete **0.83**

WT-29939

Task Category	Burner System
Title	Burner service
	Justin H 3/3/21
Description	-Replaced burner filter as per burner service -Did not touch injectors, will test/inspect during function test
Check Issue	<input type="checkbox"/>
Completed On	3/3/2021 3:30 PM
Action Taken	
Expected Time to Complete	
Time to Complete	0.67

WT-29940

Task Category	Chassis
Title	Clean up under side
	Justin H 3/3/21
Description	-Drop box was covered in oil and hard to work in, so I cleaned up the drop box and inspected hoses for defects on list
Check Issue	<input type="checkbox"/>
Completed On	3/3/2021 5:30 PM
Action Taken	
Expected Time to Complete	
Time to Complete	1.00

WT-29967

Task Category	Steering
Title	power steering oil leak
	Justin H 4/3/21
Description	-Was noted on defect list that power steering reservoir was empty and was leaking from bottom hose clamp and by cooler -I had first tightened all the clamps as they seemed to be loose and all tightened up a fair bit -I then removed the filter and had to replace power steering cap because it was over tightened, replaced filter and installed reservoir and filled -cleaned up leaking areas
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 7:40 AM
Action Taken	
Expected Time to Complete	
Time to Complete	0.80

WT-29968

Task Category	Hydraulic System
Title	Hydraulic lines chaffing
	Justin H 4/3/21
Description	-Was noted on defect list that hydraulic lines were chaffing on other lines -I had cleaned up area where oil was and inspected hoses for damage, hoses still looked like they were in good condition -I had wrapped the hose with hood guard material and zip tied up
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 9:30 AM
Action Taken	
Expected Time to Complete	

Time to Complete **1.83**

WT-29969

Task Category	Transmission
Title	transmission flush
	Justin H 4/3/21
Description	-Performed transmission flush on truck for install for new oil cooler -CEL came on for aftertreatment system, I had taken a quick look at what it could be but couldn't find it to be a small repair needs further diagnosis
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 10:15 AM
Action Taken	
Expected Time to Complete	
Time to Complete	1.00

WT-29970

Task Category	Lubrication and Service
Title	Cat pump service
	Justin H 4/3/21
Description	-I had drained cat pump system, took a while to drain so I worked on something else DB March 5 2021 -Reseal drain line. -fill with oil and adjust oilers and flow rate.
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 10:00 AM
Action Taken	
Expected Time to Complete	
Time to Complete	1.50

WT-29971

Task Category	Tank
Title	Tank inspection cover
	Justin H 4/3/21
Description	-I had cleaned up sealing surface and installed door with new Teflon around it
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 11:00 AM
Action Taken	
Expected Time to Complete	
Time to Complete	0.50

WT-29972

Task Category	Blower
Title	Blower seal
	Justin H 4/3/21
Description	-was noted on defect list that blower door seal needed to be replaced -I had cleaned up the surface and installed a new foam seal
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 11:30 AM
Action Taken	
Expected Time to Complete	
Time to Complete	0.50

WT-29974

Task Category	Transmission
---------------	---------------------

Title	Speed sensor
Description	Justin H 4/3/21 -Was noted on defect list that pigtail for transmission speed sensor was broken off -I had replaced the sensor with a new one and changed the pigtail on the truck side to a weather pack terminal
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 12:00 PM
Action Taken	
Expected Time to Complete	
Time to Complete	0.50

WT-29976

Task Category	
Title	Fuel Tank
Description	Justin H 4/3/21 -Repair Fuel Tank Step
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 12:30 AM
Action Taken	
Expected Time to Complete	
Time to Complete	0.50

WT-29978

Task Category	Electrical System
Title	Burner system not getting power
Description	Justin H 4/3/21 -Was noted on defect list that burner system was not receiving power -I had tried checking wires and possible fuses but couldn't find anything wrong with it -I then tested output on the inverter and it was not producing the 120v it needs -I then removed the old inverter and installed new one -I then looked at the terminals for the inverter and found that the negative terminal was loose, I had repaired the connector with a new terminal -tested operation of inverter and burner system and all of it was working
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 3:00 PM
Action Taken	
Expected Time to Complete	
Time to Complete	1.63

WT-29979

Task Category	Air Leak
Title	Diagnose air leak
Description	Justin H 4/3/21 -was noted on defect list of multiple air leaks -I had first looked at the one inside of the cab of the truck and found that one of the push locks for the hydraulic switch was loose, I had pushed it back together and it had stopped the leak -Looked for air leak in engine bay but could not hear or see any air leaks -Then looked at air leak at differentials for air leaks under there but could not find any aswell
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 4:00 PM
Action Taken	
Expected Time to Complete	
Time to Complete	0.75

WT-29980

Task Category	
Title	Diagnose roda not working

Description	Justin H 4/3/21 -was noted on defect list that roda was not working, I had tested the roda system and it seemed to work perfectly fine and was operating as normal
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 4:15 PM
Action Taken	
Expected Time to Complete	
Time to Complete	0.25

WT-29981

Task Category	Suspension
Title	Torque rod sheared off
Description	Justin H 4/3/21 -Was noted on defect list that last differential torque rod was sheared off and needed to be replaced -I had removed 3 of the bolts one is stuck in, tried with 3/4" impact still would not come off needed to be cut off
Check Issue	<input type="checkbox"/>
Completed On	3/4/2021 5:30 PM
Action Taken	
Expected Time to Complete	
Time to Complete	2.17

WT-29995

Task Category	Cab-Exterior
Title	Mud flaps
Description	DB March 5 2021 -Adjust anti sail brackets and put mud flaps in hangers -Change out D/S rear mud flap. -go over repair list with co worker
Check Issue	<input type="checkbox"/>
Completed On	3/5/2021 11:00 AM
Action Taken	
Expected Time to Complete	
Time to Complete	1.00

WT-29996

Task Category	Exhaust
Title	Stack bushings
Description	DB March 5 2021 -Change out stack bushings -change cabin air filter.
Check Issue	<input type="checkbox"/>
Completed On	3/5/2021 1:00 PM
Action Taken	
Expected Time to Complete	
Time to Complete	1.00

WT-29997

Task Category	Miscellaneous
Title	odd jobs
Description	DB March 5 2021 -Diag rear ID light replaced bulb. -Adjust brakes with co worker and free up sticking slack adjuster. -Diag leak/stain around fuel tank. clean up mess.
Check Issue	<input type="checkbox"/>

Completed On	3/5/2021 4:00 PM
Action Taken	Check; Repair; Replace; Diagnose
Expected Time to Complete	
Time to Complete	3.00

WT-29999

Task Category	Engine
Title	Aftertreatment
	DB March 5 2021
Description	-Diag codes with co worker -notes and clean tools
Check Issue	<input type="checkbox"/>
Completed On	3/5/2021 6:00 PM
Action Taken	
Expected Time to Complete	
Time to Complete	1.00

WT-30004

Task Category	Brake System
Title	Brake pot replacement
	Justin H 5/3/21
Description	-Was noted on defect list that 2nd drive axle brake pots needed to be replaced -I had removed the old ones and replaced them with new ones -I installed new slack bushings as well -Adjusted brakes and tested for leaks and proper operation
Check Issue	<input type="checkbox"/>
Completed On	3/5/2021 3:00 PM
Action Taken	
Expected Time to Complete	
Time to Complete	5.75

WT-30005

Task Category	Lamps and Reflectors
Title	Diagnose doghouse lights
	Justin H 5/3/21
Description	-Noted on work order that passenger side doghouse light was dim and was flickering -I had looked at the light and it did not seem dim, I also tried to make the light flicker but I couldn't
Check Issue	<input type="checkbox"/>
Completed On	3/5/2021 3:37 PM
Action Taken	
Expected Time to Complete	
Time to Complete	0.25

WT-30006

Task Category	Hydraulic System
Title	top off hydraulic oil
	Justin H 5/3/21
Description	-Was noted on defect list that hydraulic oil was low -I had topped off oil level
Check Issue	<input type="checkbox"/>
Completed On	3/5/2021 4:00 PM
Action Taken	
Expected Time to Complete	
Time to Complete	0.25

WT-30008

Task Category	Engine
Title	Check engine light
Description	Justin H 5/3/21 -CEL was turned on when truck was doing transmission flush -Light was for aftertreatment system, def dozer was not responding to signal -I had taken the def dozer off of the decomp tube and performed a def dozer override test to ensure that the system was working properly and nozzle was not blocked -Test was performed and it went successfully, spray pattern looked good and it was building proper pressure -Codes were cleared and truck was ran to verify codes wouldn't come back 7/3/21 Light came back on when outside doing function test for aftertreatment DEF Dozer not responding, I had performed a test again on the dozer to analyze how much fluid was coming out, it turns out it was over injecting DEF into the decomp tube, I had took dozer off of deleted truck and tested and it was in spec for the test, Installed with a new gasket 8/3/21 -Took truck outside to do a regen and it performed a regen with no codes that showed up -Andy took it for a road test and when it came back it had the CEL back on -The codes were for manifold pressure sensor data valid but erratic, Turbo speed sensor data valid but erratic, and Coolant temperature sensor (high coolant temp) -First I took a look at the turbo speed sensor and I had found that the sensor itself was reading OL when it should have been between 600-1500 OMHs, I had stole a sensor off of another truck and installed it on, code went inactive -I then looked at the at the manifold pressure sensor I and I had taken the truck outside and tested the truck and got the truck up to operation conditions and the code was inactive -The last code I looked at the sensor and wiring to see if it was getting proper voltage and resistance and it was, I didn't think about looking into the rad until Andy told me and we found a little bit of mud at the bottom, cleared out the mud from the bottom with garden hose -Truck is ready for another road test
Check Issue	<input type="checkbox"/>
Completed On	3/5/2021 5:30 PM
Action Taken	
Expected Time to Complete	
Time to Complete	17.67

WT-30010

Task Category	Cab-Interior
Title	Laptop port
Description	Justin H 6/3/21 -I noticed that port for laptop was broken from plastics and couldn't install cord to it -I had installed a few screws into the plastic flange of port to hold it in place
Check Issue	<input type="checkbox"/>
Completed On	3/6/2021 8:05 AM
Action Taken	
Expected Time to Complete	
Time to Complete	0.33

WT-30011

Task Category	Gauge
Title	5k Gauge stuck
Description	Justin H 6/3/21 -I noticed that 5k gauge in doghouse was stuck -I had replaced it with a 6k gauge put certification in cab and to work order
Check Issue	<input type="checkbox"/>
Completed On	3/6/2021 8:25 AM
Action Taken	
Expected Time to Complete	
Time to Complete	0.33

WT-30026

Task Category	Body and Frame
Title	Replace leaking ball valves
	Justin H 6/3/21
Description	-Found multiple ball valves leaking and bypassing on the trucks plumbing going into the doghouse -First ball valve was the one 1 1/2" that was bypassing and was not sealing, I had replaced the ball valve and hose that was on the barb fittings -second ball valve was load drain ball valve and it was cracked down the back of it and handle was missing off of it, I replaced it with a new 1/2" ball valve -Last ball valve is the 2" one going into doghouse, was bypassing, I Removed the old one still need to install new one
Check Issue	<input type="checkbox"/>
Completed On	3/6/2021 5:35 PM
Action Taken	
Expected Time to Complete	
Time to Complete	3.33

WT-30057

Task Category	Miscellaneous
Title	Misc small repairs
	Justin H 8/3/21
Description	Found a few small repairs that needed to be completed -Beacon light out, inspected beacon light found it was burnt up, I replaced light with new one and wired, tested operation -Camlock cap with no tether, I installed the camlock cap for 2" drain and attached tether to it
Check Issue	<input type="checkbox"/>
Completed On	3/8/2021 11:00 AM
Action Taken	
Expected Time to Complete	
Time to Complete	1.00

WT-30182

Task Category	Cooling System
Title	Rad overheating
	Justin H 9/3/21
Description	-Andy had noticed that radiator was heating too much during road test -We had looked at the problem and found that the radiator had some mud in it, I then had removed the air to air cooler to clean the radiator better and found that the inside of the air to air was full of mud and the condenser was too, I then cleared out as much mud as possible from the air to air radiator and condenser as possible, Installed all components back on to truck and Andy took it for another road test and he was happy with the results
Check Issue	<input type="checkbox"/>
Completed On	3/9/2021 3:00 PM
Action Taken	
Expected Time to Complete	
Time to Complete	7.00

WT-30231

Task Category	Road Test
Title	Road test.
	AK-Mar 6, 2021: Pre-trip, issues found so showed Hapgood. Second pre-trip ok. Found several issues on the road test. (Low power, no boost gauge, overheating, wiper sprayer no good, and a couple other things). Told Hapgood about them.
Description	AK Mar 7: Second road test revealed overheating issue still present. Checked the radiator and found that it was still very plugged. AK-Mar 8, 2021: Pre-trip, road test. -ok-
Check Issue	<input type="checkbox"/>

Completed On **3/8/2021 3:00 PM**

Action Taken

Expected Time to Complete

Time to Complete **3.00**

Work Order Items

AX Item Id	1008701
Work Order Task	
Catalog Item	Chevron Delo 400 15W-40 SDE Semi Synthetic Engine Oil Bulk CHE-222290-01
Parts Item Status	Received
Cost	\$3.24
Planned Quantity	46.00
Actual Quantity	46.00
Quantity On Hand	10,240
Warehouse	Fort McMurray 01
AX Item Id	1007782
Work Order Task	
Catalog Item	Oil Sample Bottle Fluid Life MIS-OILAM-02
Parts Item Status	Received
Cost	\$13.95
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	95
Warehouse	Fort McMurray 01
AX Item Id	1004928
Work Order Task	
Catalog Item	Electrical,Sensor,Differential,9000-00564
Parts Item Status	Received
Cost	\$166.35
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	14
Warehouse	Fort McMurray 01
AX Item Id	1004092
Work Order Task	
Catalog Item	3" Bi-Metal Thermometer, III 33025AO10G4
Parts Item Status	Received
Cost	\$39.49
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	8
Warehouse	Fort McMurray 01
AX Item Id	1008561
Work Order Task	
Catalog Item	Fuel/Water Seperator Filter, FS19802FLG

Parts Item Status **Received**
Cost **\$14.48**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **14**
Warehouse **Fort McMurray 01**

AX Item Id **1004187**
Work Order Task
Catalog Item **Hydraulic Filter, HF6710FLG**
Parts Item Status **Received**
Cost **\$10.63**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **27**
Warehouse **Fort McMurray 01**

AX Item Id **1008540**
Work Order Task
Catalog Item **Hydraulic Filter, HF6555FLG**
Parts Item Status **Received**
Cost **\$29.31**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **6**
Warehouse **Fort McMurray 01**

AX Item Id **1003368**
Work Order Task
Catalog Item **Brake Clean, KLF 313**
Parts Item Status **Received**
Cost **\$2.99**
Planned Quantity **12.00**
Actual Quantity **12.00**
Quantity On Hand **1,925**
Warehouse **Fort McMurray 01**

AX Item Id **1007273**
Work Order Task
Catalog Item **2.69" - 3" HD T-Bolt Clamp, PCR 380044**
Parts Item Status **Received**
Cost **\$8.15**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **14**
Warehouse **Fort McMurray 01**

AX Item Id **1004145**

Work Order Task
Catalog Item **Power Steering Filter, 3937557SFLG**
Parts Item Status **Received**
Cost **\$9.22**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **9**
Warehouse **Fort McMurray 01**

AX Item Id **1004505**
Work Order Task
Catalog Item **Power Steering Cap, Q347367FLG**
Parts Item Status **Received**
Cost **\$10.67**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **9**
Warehouse **Fort McMurray 01**

AX Item Id **1004379**
Work Order Task
Catalog Item **Mobil Automatic Transmission Fluid D/M 1L (123003)**
Parts Item Status **Received**
Cost **\$4.99**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **524**
Warehouse **Fort McMurray 01**

AX Item Id **1003281**
Work Order Task
Catalog Item **Textured Disp PF Nitrile Glove 4mil Large (100/box) DSI GP2910-L**
Parts Item Status **Received**
Cost **\$21.95**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **114**
Warehouse **Fort McMurray 01**

AX Item Id **1003253**
Work Order Task
Catalog Item **1" Sight Glass HSG100**
Parts Item Status **Received**
Cost **\$18.31**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **7**
Warehouse **Fort McMurray 01**

AX Item Id	1008772
Work Order Task	
Catalog Item	D/S Mirror Control Switch Heated Peterbilt Q27-6016-002
Parts Item Status	Received
Cost	\$207.48
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	2
Warehouse	Fort McMurray 01

AX Item Id	1004678
Work Order Task	
Catalog Item	Lights,Flashers,Tube,TAR 43929095
Parts Item Status	Received
Cost	\$64.40
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	10
Warehouse	Fort McMurray 01

AX Item Id	1007999
Work Order Task	
Catalog Item	1/4" Spring Return Ball Valve VBA-0140
Parts Item Status	Received
Cost	\$53.92
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	6
Warehouse	Fort McMurray 01

AX Item Id	1002872
Work Order Task	
Catalog Item	Ball Switch N.C, POL 21465
Parts Item Status	Received
Cost	\$18.94
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	16
Warehouse	Fort McMurray 01

AX Item Id	1004263
Work Order Task	
Catalog Item	Lube Filter, LF14001NNFLG
Parts Item Status	Received
Cost	\$30.39
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	67

Warehouse **Fort McMurray 01**

AX Item Id **1004348**
Work Order Task
Catalog Item **Fuel Filter, FF5825NNFLG**
Parts Item Status **Received**
Cost **\$37.30**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **74**
Warehouse **Fort McMurray 01**

AX Item Id **1004355**
Work Order Task
Catalog Item **Fuel/Water Separator Filter, FS36401FLG**
Parts Item Status **Received**
Cost **\$17.96**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **67**
Warehouse **Fort McMurray 01**

AX Item Id **1003280**
Work Order Task
Catalog Item **Textured Disp PF Nitrile Glove 4mil XL (100/box) DSI GP63-532PF-XL**
Parts Item Status **Received**
Cost **\$16.75**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **80**
Warehouse **Fort McMurray 01**

AX Item Id **1005250**
Work Order Task
Catalog Item **24" x 14" HD Black Mud Flap, B2414**
Parts Item Status **Received**
Cost **\$13.74**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **4**
Warehouse **Fort McMurray 01**

AX Item Id **1003203**
Work Order Task
Catalog Item **3030 Short Stroke Brake Pot, SB3030CC**
Parts Item Status **Received**
Cost **\$55.32**
Planned Quantity **2.00**

Actual Quantity **2.00**
Quantity On Hand **12**
Warehouse **Fort McMurray 01**

AX Item Id **1008414**
Work Order Task
Catalog Item **Air Cab Filter, CFR19010**
Parts Item Status **Received**
Cost **\$11.03**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **29**
Warehouse **Fort McMurray 01**

AX Item Id **1008389**
Work Order Task
Catalog Item **5/8" x 5/8" Pin Clevis, MID CF3**
Parts Item Status **Received**
Cost **\$6.32**
Planned Quantity **2.00**
Actual Quantity **2.00**
Quantity On Hand **15**
Warehouse **Fort McMurray 01**

AX Item Id **1007836**
Work Order Task
Catalog Item **Cat Pump, Oil, 4L JUG**
Parts Item Status **Received**
Cost **\$22.46**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **17**
Warehouse **Fort McMurray 01**

AX Item Id **1008545**
Work Order Task
Catalog Item **Guage,4",0-6000psi,1/2 NPT BM, Re-Calibrated**
Parts Item Status **Received**
Cost **\$91.80**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **8**
Warehouse **Fort McMurray 01**

AX Item Id **1003282**
Work Order Task
Catalog Item **Textured Disp PF Nitrile Glove 4mil Medium (100/box) DSI GP2910-M**
Parts Item Status **Received**

Cost **\$16.75**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **72**
Warehouse **Fort McMurray 01**

AX Item Id **1005078**
Work Order Task
Catalog Item **Stainless Steel Camlock, 2" Dust Cap, Locking DC200SS**
Parts Item Status **Received**
Cost **\$88.43**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **11**
Warehouse **Fort McMurray 01**

AX Item Id **1005036**
Work Order Task
Catalog Item **2IN BALL VALVE 600WOG FULL PORT BV-32**
Parts Item Status **Received**
Cost **\$37.01**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **16**
Warehouse **Fort McMurray 01**

AX Item Id **1008814**
Work Order Task
Catalog Item **DEF Doser Gasket Cummins 4354280**
Parts Item Status **Received**
Cost **\$45.96**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **3**
Warehouse **Fort McMurray 01**

AX Item Id **1008815**
Work Order Task
Catalog Item **DEF Doser Gasket Thermal Isolator Cummins 2885889**
Parts Item Status **Received**
Cost **\$10.82**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **3**
Warehouse **Fort McMurray 01**

AX Item Id **1008828**
Work Order Task

Catalog Item	90' Elbow 3/8" Normaquick, 0715853010FTG
Parts Item Status	Received
Cost	\$3.12
Planned Quantity	2.00
Actual Quantity	2.00
Quantity On Hand	12
Warehouse	Fort McMurray 01

AX Item Id	1002735
Work Order Task	
Catalog Item	LED Headlamp Energizer ENHDB32E
Parts Item Status	Received
Cost	\$12.95
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	85
Warehouse	Fort McMurray 01

AX Item Id	1008152
Work Order Task	
Catalog Item	Ceda Bump Hat, 70862
Parts Item Status	Received
Cost	\$12.99
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	31
Warehouse	Fort McMurray 01

AX Item Id	1008212
Work Order Task	
Catalog Item	Water Filter, WF2127FLG
Parts Item Status	Received
Cost	\$22.40
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	7
Warehouse	Fort McMurray 01

AX Item Id	1004085
Work Order Task	
Catalog Item	2-1/2" 1/4" NPT -30/30 PSI Gauge, WIK 9306085UC
Parts Item Status	Received
Cost	\$28.76
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	12
Warehouse	Fort McMurray 01

AX Item Id **1008677**
Work Order Task
Catalog Item **Exhaust Mount Pin Isolator M13-6004**
Parts Item Status **Received**
Cost **\$7.17**
Planned Quantity **2.00**
Actual Quantity **2.00**
Quantity On Hand **8**
Warehouse **Fort McMurray 01**

AX Item Id **1008074**
Work Order Task
Catalog Item **WypAll Wet Wipes 21KCC58310**
Parts Item Status **Received**
Cost **\$8.95**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **44**
Warehouse **Fort McMurray 01**

AX Item Id **1002754**
Work Order Task
Catalog Item **567 Threadlocker Sealant 50ml, LCT 2087067**
Parts Item Status **Received**
Cost **\$21.44**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **21**
Warehouse **Fort McMurray 01**

AX Item Id **1008096**
Work Order Task
Catalog Item **Safety Glasses Clear Lens NOR A700**
Parts Item Status **Received**
Cost **\$1.65**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **700**
Warehouse **Fort McMurray 01**

AX Item Id **1004599**
Work Order Task
Catalog Item **Amber Beacon Light, TAR 100SPA**
Parts Item Status **Received**
Cost **\$116.80**
Planned Quantity **1.00**
Actual Quantity **1.00**
Quantity On Hand **10**
Warehouse **Fort McMurray 01**

AX Item Id	1002531
Work Order Task	
Catalog Item	Engine Belt, D84-1000-6122180
Parts Item Status	Received
Cost	\$95.23
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	9
Warehouse	Fort McMurray 01

AX Item Id	1008453
Work Order Task	
Catalog Item	W/Star D/Valve On/Off, GTD 3240 7
Parts Item Status	Received
Cost	\$76.10
Planned Quantity	2.00
Actual Quantity	2.00
Quantity On Hand	5
Warehouse	Fort McMurray 01

AX Item Id	1002968
Work Order Task	
Catalog Item	Sensor,Pressure,Temperature,2897334CUM
Parts Item Status	Received
Cost	\$75.72
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	6
Warehouse	Fort McMurray 01

AX Item Id	1008472
Work Order Task	
Catalog Item	Fruitland Pump Rebuild
Parts Item Status	Received
Cost	\$5,534.75
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	4
Warehouse	Fort McMurray 01

AX Item Id	1005738
Work Order Task	
Catalog Item	Heated Mirror SS Convex 8-1/2", TKL 97614
Parts Item Status	Received
Cost	\$60.29
Planned Quantity	1.00
Actual Quantity	1.00
Quantity On Hand	11

AX Item Id **1008472**
Work Order Task
Catalog Item **Fruitland Pump Rebuild**
Parts Item Status **Stock Return**
Cost **\$5,534.75**
Planned Quantity **-1.00**
Actual Quantity **-1.00**
Quantity On Hand
Warehouse **Fort McMurray 01**

Work Order Third Parties
WO3P-0008660

Account **Stahl Peterbilt-Edmonton**
Date **3/13/2021**
Description **Turbo Speed sensor Kit**
Total Cost **\$260.48**
Quantity **1**
Part# **5550060CUM**
ETA **3/13/2021**

WO3P-0008659

Account **Stahl Peterbilt-Edmonton**
Date **3/2/2021**
Description **Kit-Heat Exchanger**
Total Cost **\$565.48**
Quantity **1**
Part# **K3898**
ETA **3/2/2021**