

INVOICE

Printed Date: 06/04/2024 **Work Completed: 06/04/2024**

Vehicle Information

1997 Class A Diesel - Freightliner -

Lic # :

Odometer In : 82011

Home  CELL 

VIN # : 4UZ6XJBC1 VC777372

Hat # : rs

Part Description	Qty	Sale	Ext	Labor Description	Ext
ONAN EXHAUST HANGER	1.00	41.44	41.44	THIRD NUMBER MISSING ON ODOMETER	n/c
ONE DYE CHARGE	1.00	0.00	n/c	BETWEEN 2 & 1	
FREON FOR SERVICE UP TO 3.5 PDS.	1.00	0.00	n/c	NOT CHANGING OIL DUE TO OIL LEAK, GREASED CHASSIS	84.50
A/C R134a OE Low Side Service Cap - Light Ble	1.00	11.09	11.09	Greased chassis.	
A/C R134A OE High Side Service Cap - Light Blue	1.00	11.09	11.09	MECHANICAL INSPECTION	449.00
1/2" PEX TO POLY B ADAPTER	1.00	9.38	9.38	IN VEHICLE	
1/2" PEX CLAMPS	2.00	3.10	6.20	Test wipers, horn & exterior light operation	
PEX PIPE PER FOOT	0.50	2.38	1.19	Advise customer of any warning lamps on dash	
1/2 pex x 1/2 90 degree fitting	1.00	6.90	6.90	ON HOIST	
WWASHER FLUID- BULK PER LITRE	3.00	1.35	4.05	Check tire pressures & condition	
Shop Supplies			219.43	Check front end	
				Visual inspection of brakes, good	
				-push rod lengths checked , 1 7/16 to 1 1/2, good.	
				Visually inspect undercarriage including drivetrain & exhaust systems	
				Visually check for any leaks	
				UNDER HOOD	
				Inspect condition of air filter, belts & hoses	
				Visually inspect battery	
				Check fluid levels	
				Note any recommendations & advise	
				Technician Findings;	
				-Tires are cracking and dated 2006	
				-2 clearance lights out [1 front and 1 rear]	
				-Chassis A/C is not working	
				-Oil pan has an oil leak	
				-Transmission seal and diff seal are sweating, monitor	
				-Generator exhaust pipe hanger broken	
				CHECK IF BACK UP CAMERA IS ADJUSTABLE	n/c
				Customer states camera is facing straight down, wants to know if we can adjust.	
				Technician noted, backup camera is not adjustable.	
				CHECK & REPAIR FRONT & REAR CLEARANCE LIGHTS	97.50
				Checked and repaired ground at rear clearance light. Front light will require replacement, at this time we are not able to source replacement light. Roger spoke with James and will leave for now.	
				REPLACE GEN SET EXHAUST HANGER/ CLAMP	97.50
				Technician removed damaged generator exhaust hanger and installed new.	
				CHECK AC SYSTEM PRESSURE & CHARGE WITH NITROGEN	195.00
				Pressured up to 80 psi no drop found at this time. No caps were on service fittings. Pump does cycle. Would recommend recharging next and monitor for any leaks with dye.	
				AIR CONDITIONING RECHARGE HD	289.89

COPY

Namao Automotive Repair Ltd.
 #32 24400-HWY 37
 Sturgeon County, AB. T8T 0E9
 Phone: 780-973-3373 Fax: 780-973-3672
 Your Complete Automotive Maintenance Facility

INVOICE

64625

Org. Est. # 075685
 105152797 RT

INVOICE

Printed Date: 06/04/2024

Work Completed: 06/04/2024

Customer Name: [REDACTED]

1997 Class A Diesel - Freightliner -

Vehicle Year/Make/Model: [REDACTED]

Lic # :

Odometer In : 82011

Home Address: [REDACTED]

VIN # : 4UZ6XJBC1 VC777372

Hat # : rs

Part Description	Qty	Sale	Ext	Labor Description	Ext
------------------	-----	------	-----	-------------------	-----

Inspected condition of all belts and lines. Evacuated and recharged with reclaimed or new R-134A[Up to 3 1/2 lbs.]. Installed dye and tested for leaks. Tested system performance.

DEWINTERIZE & PRESSURE TEST WATER SYSTEM (UNDER 30FT) 98.89

Customer states plug may have been left in for the winter.

Dewinterize water system. Operation of pump is to be checked followed by pressurization of water system and leaks in system are checked. Any deficiencies will be reported to customer.

Technician Findings;

- Has poly bead line
- Water leaking on left side behind control panel
- Fridge has yellow residue [sign of leak]
- No water at drinking tap[leave off]
- No water to ice maker[customer aware]
- There was napkins under water filter, leaking at this time

PULL PANEL TO LOCATE WATER LEAK & REPAIR 682.50

Technician pulled water panel to gain access to leak. Installed an adapter fitting from pex to poly bead to replace damaged hose connection. Installed new fitting. Pressured up system, no leaks detected at this time. Reassembled.

NOTE :SYSTEM HAS HAD FLORESCENT GREEN DYE ADDED TO THE 134A TO DETECT A LEAK. 134A IS COLORLESS AND ODORLESS. FOR A SMALL LEAK IN THE SYSTEM IT MAY TAKE TIME TO LOCATE. CUSTOMER WILL HAVE TO MONITOR THE PERFORMANCE AND IF ANY DYE IS SEEN RETURN FOR FURTHER REPAIR. NAMAO WILL RECHECK FOR A LEAK WITH OUR UV LIGHT FREE OF CHARGE. THERE IS NO REFUND OR WARRANTY ON RECHARGE DUE TO A LEAK IN THE SYSTEM.

Disconnect located above man door, customer prefers batteries to be disconnected while it is parked. Batteries are located on driver side in the back storage compartment.

[Recommendations]

- W/P LOCATION / remote valve
- HOT WATER HEATER BYPASS LOCATION/ remote valve
- OUTSIDE SHOWER-yes
- WASHING MACHINE-yes
- ICE MAKER-yes- not hooked up
- WATER TAP AT SINK-shut off
- NOTE : POLY BEAD WATER LINE

COPY

Namao Automotive Repair Ltd.
 #32 24400-HWY 37
 Sturgeon County, AB. T8T 0E9
 Phone: 780-973-3373 Fax: 780-973-3672
 Your Complete Automotive Maintenance Facility

INVOICE

64625

Org. Est. # 075685
 105152797 RT

INVOICE

Printed Date: 06/04/2024

Work Completed: 06/04/2024

1997 Class A Diesel - Freightliner -

Lic #:

Odometer In : 82011

Home 1888-888-8888 CELL 780-973-3373

VIN # : 4UZ6XJBC1 VC777372

Hat # : rs

Part Description	Qty	Sale	Ext	Labor Description	Ext
------------------	-----	------	-----	-------------------	-----

Org. Estimate	1,729.43	Revisions	0.00	Current Estimate	1,729.43
---------------	----------	-----------	------	------------------	----------

Labor:	1,994.78
Parts:	310.77
SubTotal:	2,305.55
Tax:	115.28
Total:	2,420.83
Bal Due:	\$2,420.83

[Payments -]

Vehicle Received: 5/13/2024

Customer Number : 8250

I hereby authorize the repair work hereabove set forth to be done along with the necessary parts and material. I agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond our control. An express mechanics lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. Warranty on parts and labor is 1 yr or 20,000 km whichever comes first. All warranty work must be performed in our shop & cannot exceed the original cost of the repair.

Signature _____ Date _____

Visit us on the web: www.namaoautomotive.ca

Email Address: namaoautomotive@telus.net