

J210C



Calgary, ALBERTA CAN
Ph.4032641221, Fax.403
cutterup@outlook.com

GP204

GST 83065 3788 RT001

WORKORDER - COMPLETED

WorkOrder Date : 07-23-2019

WorkOrder Number : 7458

Bill to :



PURC

07-23-2019

Acct # *****

Card Type DP

Name:

A0000002771010

Trace # 1299

Inv. # 1522

Auth # 675065

Total

(001) APPROVE

Retain this copy
record
Customer

Make	Model	VIN	Liter	CID	Engine Co
GUMMINS	DIESEL	2004	5.9	359	

Parts	1127.10	Parts Tax	5.000	%
Labor	880.00	Labor Tax	5.000	%
Misc.	150.00	Other	5.000	%
Sub Model	2157.10	Total	2264.96	

~~2164.7~~

Labor	Qty	Each	Total
DEGREASE,MAG AND PREP	1	185.00	185.00
BORE AND FIT PISTONS-ADVISE ON SIZE	5	65.00	325.00
re and re cam bearings and gallery plugs	1	145.00	145.00
install sleeve and finish to size	1	225.00	225.00

Parts	Qty	Each	Total
ESTIMATE PARTS	1	0.00	0.00
224-3673WR.020 Mahle Piston Kit with rings	1	1025.00	1025.00
cam bearings	2	18.95	37.90
csi157 repair sleeve	1	49.95	49.95
GALLERY PLUGS	3	4.75	14.25

Misc	Qty	Each	Total
deposit 1100.00 on june 5-19	1	0.00	0.00
shop supplies.enviro	1	150.00	150.00

Paid \$ 1000.00
Debit #
675065

07-23-2019 11:06 AM



GST 83065 3788 RT001


Ph: 4032641221 Fax: 4032641221
cutterup@outlook.com

INVOICE - COMPLETED

Invoice Date : 07-26-2019

Invoice Number : 7502

Bill to :

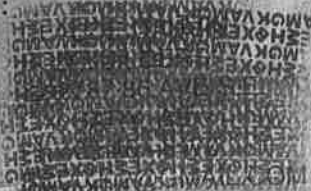

Acc
Car
Name
A000

Trace
Inv.
Auth

Total
(0)

Make	Model	VIN	Liter	CID	Engine
Parts	909.52			Parts Tax 5.000	%
Labor	165.00			Labor Tax 5.000	%
Misc.	9.32			Other 5.000	%
Sub Model	1083.84			Total	1138.03

Labor	Qty	Each	Total
POLISH CRANK	1	165.00	165

Parts	Qty	Each	Total
MS2328P MAIN BEARINGS	1	112.89	112
CB1873AP mahle connecting rod bearings	6	16.95	101
HS54556 Mahle head gasket set	1	499.98	499
CS54556 Lower eng set	1	194.95	194

Misc	Qty	Each	Total
SHOP SUPPLIES/ENVIRO	1	9.32	9.32

LAD'S AUTO
Keeping Canadians on the road since 1985



Win \$100.00 by taking our online survey
<http://surveys.asklistenretain.com/s3/napaaautopro>



TIRELAND

AUTOPRO

WWW.LADSAUTO.COM 3832-16 Street SE Calgary, AB T2G 3R7 Ph: (403) 263-0225 Fax: (403) 237-0321

DIESEL FUEL PRESSURE TEST

Your car's fuel pump is used to supply gas to the engine's fuel injectors whether it be gasoline or diesel fuels. A fuel pump test will show the performance condition of the pump for pressure and volume.

Labor

Technician: Braydon Schneider / Service Advisor: David Dansereau \$155.67 G

Sub **\$155.67**

FUEL PRESSURE LIMITING VALVE, REPLACE (FAULTY)

Remove and Replace components as required to access and install materials, and/or perform needed service. Retest and verify repair as required. Perform final road test where applicable.

Remove & Replace Fuel Pressure Regulator

Technician: Braydon Schneider / Service Advisor: David Dansereau \$140.10 G

3947799 - Pressure Relief Valve

1 Unit \$1,306.25 / Unit **\$1,306.25 G**

Technician: Braydon Schneider / Service Advisor: David Dansereau

Freight

1 Unit \$57.14 / Unit **\$57.14 G**

Technician: Braydon Schneider / Service Advisor: David Dansereau

Sub **\$1,503.49**

COMPLIMENTARY EXTERIOR DETAIL - HAND WASH & DRY

Includes bug removal, snow and dirt - leaving your car shiny and new.

Exterior Detail

Technician: Jason Balisacan / Service Advisor: David Dansereau \$10.00 G

Discount Sub **(\$10.00)**
Sub **\$0.00**

Total Parts

Total Labor

Total Before Taxes & Miscellaneous Charges

\$1,364.87

\$295.77

\$1,660.64

(SE) Materials and Consumables / Hazardous Waste Disposal Fee*

(G) Canadian Goods and Services Tax (GST)

5 %

\$32.54 G

\$84.66

Grand Total

\$1,777.84

Total discounts applied is \$321.34

Dauvin, Claude paid \$1,777.84 by Waiting for Payment

BAYIQ Card XXXXXXXXXXXX9379 used on this invoice.

Warranty: New parts - 2 year/40,000 from invoice date incl. 2 year on labour. Some exclusions apply. **No warranty provided on the following items:** Client supplied parts, Commercial vehicles, Transmission & transaxles, Gaskets & Seals Drive axle / Differential assemblies, Autobody, paint, & molding repairs - please see attached NAPA/Autopro "Peace of Mind Warranty" folder for complete details or call 1-866-GET-NAPA. Used parts - 30 day warranty, excluding labour. Warranties are non-transferrable. Warranty work not exceed the original cost of repair. No warranty on owner provided parts. Original invoice must be presented for warranty approval at our shop. We have the right to refuse warranty due to abuse or neglect. I have understood and authorized the above repairs. By signing this, I acknowledge my indebtedness of the invoice amount and agree to pay in its entirety.

PA AUTOPRO Store# 4822 W-0207-00

Signature X _____

Date _____

3/2022 4:47 PM

AUTO
LADS on the road since 1985



Win \$100.00 by taking our online survey
<http://surveys.asklistenretain.com/s3/napaautopro>

TIRELAND



WWW.LADSAUTO.COM 3832-16 Street SE Calgary, AB T2G 3R7 Ph: (403) 263-0225 Fax: (403) 237-0321

Remove & Replace Transmission Pressure Sensor			\$435.88 G
Technician: Braydon Schneider / Service Advisor: Samantha Ellis			
16493 - Transmission Pressure Sensor	1 Unit	\$280.98 / Unit	\$280.98 G
Technician: Braydon Schneider / Service Advisor: Samantha Ellis			
11487 - Automatic Transmission Gasket, Oil Pan - Rubber	1 Unit	\$77.53 / Unit	\$77.53 G
Coated Metal - OE Style - Platinum			
Technician: Braydon Schneider / Service Advisor: Samantha Ellis			

Sub \$794.39

Total Parts	\$415.33
Total Labor	\$435.88
Total Before Taxes & Miscellaneous Charges	\$851.21
(SE) Materials and Consumables / Hazardous Waste Disposal Fee	\$73.49 G
(G) Canadian Goods and Services Tax (GST)	5% \$46.24
Grand Total	\$970.94

Total discounts applied is \$311.34

Dauvin, Claude paid \$970.94 by Waiting for Payment

BAYIQ Card XXXXXXXXXXXX9379 used on this invoice.

Warranty: New parts - 2 year/40,000 from invoice date incl. 2 year on labour. Some exclusions apply. **No warranty provided on the following items:** Client supplied parts, Commercial vehicles, Transmission & transaxles, Gaskets & Seals Drive axle / Differential assemblies, Autobody, paint, & molding repairs - please see attached NAPA/Autopro "Peace of Mind Warranty" folder for complete details or call 1-866-GET-NAPA. Used parts - 30 day warranty, excluding labour. Warranties are non-transferrable. Warranty work cannot exceed the original cost of repair. No warranty on owner provided parts. Original invoice must be presented for warranty approval at our shop. We have the right to refuse warranty due to abuse or neglect. I have understood and authorized the above repairs performed. By signing this, I acknowledge my indebtedness of the invoice amount and agree to pay in its entirety.

NAPA AUTOPRO Store# 4822 W-0207-00

Signature X _____

Date _____

AUTO



Win \$100.00 by taking our online survey
http://surveys.asklistenretain.com/s3/napaaautopro



TIRELAND

AUTOPRO

WWW.LADSAUTO.COM 3832-16 Street SE Calgary, AB T2G 3R7 Ph: (403) 263-0225 Fax: (403) 237-0321

SUBLET DIESEL REPAIR

Got engine hot, installed return flow test fitting and performed injector return flow test. Limit is 180ml - engine produced over 350ml return fuel through injectors. With a high number, Cummins recommends replacement of all 6 injectors. Also recommend valve adjust while apart, valve cover gasket is currently leaking. Customer requested us to identify the problem with the cylinders. Re-installed return flow test fitting and performed injector return flow test. Began to cap off each individual injector line to isolate cylinders. During the process, we found several retaining nuts on injector connector tubes loose. Tightened up cylinder #1 and found the return rate went way down. Removed all injector lines - found them to be dirty, particularly in the cone shaped connection. Removed connectors and cleaned up ends. Inspected inside as best we could and cleaned out debris. Re-installed connectors and torqued retaining nuts to the proper specifications. Cleaned all fuel lines, re-installed and torqued nuts. Removed lines at the limiting valve - found it leaking. Repaired with new washers. Washed off all diesel fuel from engine. Took vehicle on road - found no issues with engine operation. The transmission temperature light intermittently flashes on the dash. Checked the level and found that it is overfilled, potentially causing the issue.

Note: Oil leak from what appears to be the oil pan, recommend pressure wash and confirm. Transmission cooler is leaking, oil is being sprayed back into the radiator causing it to plug up with oil/dirt, replacement of cooler and wash the radiator is required. Both front axle u-joints are completely rusted out, all needle bearings are gone and have large amounts of play. Rear axle seals are leaking - right is worse than left. Oil is leaking between transmission and transfer case - one of 2 seals is leaking, recommend to remove and replace seals.

Diesel Sublet Repair
Service Advisor: Courtney Dansereau

\$1,793.15 G

Sub \$1,793.15

RADIATOR ASSEMBLY & HOSES, TEST FOR BLOCKAGES (TEMPERATURE GAUGE GOES TO HOT)

Remove and Replace components as required to access and install materials, and/or perform needed service. Additional fluids may be required to complete this service. Retest and verify repair as required. Perform final road test where applicable.

Labor \$124.54 G

Technician: David Dansereau / Service Advisor: Courtney Dansereau

Sub \$124.54

RADIATOR ASSEMBLY, REPLACE (PLUGGED - CAUSING OVERHEATING)

Remove and Replace components as required to access and install materials, and/or perform needed service. Additional fluids may be required to complete this service. Retest and verify repair as required. Perform final road test where applicable.

Remove & Replace Radiator \$342.47 G

Technician: Russell Leadley / Service Advisor: Courtney Dansereau

CU2711 - Radiator - 1 Unit \$685.70 / Unit \$685.70 G

Technician: Russell Leadley / Service Advisor: Courtney Dansereau

GO5002 - QSP - ANTIFREEZE COOLANT, Global Premix 20 Unit \$5.02 / Unit \$100.40 G

50/50

Technician: Russell Leadley / Service Advisor: Courtney Dansereau

Sub \$1,128.57

Total Parts	\$1,011.10
Total Labor	\$622.68
Total Sublet	\$1,793.15
Total Before Taxes & Miscellaneous Charges	\$3,426.93

(SE) Materials and Consumables / Hazardous Waste Disposal Fee* \$102.81 G

(G) Canadian Goods and Services Tax (GST) 5% \$176.49

Grand Total \$3,706.23

Total discounts applied is \$311.34

Dauvin, Claude paid \$3,706.23 by Waiting for Payment

BAYIQ Card XXXXXXXXXXXX9379 used on this invoice.

6/30/2022 5:04 PM

Invoice #67039

Page 2 of 3



GST# R102929668