

# STONEHAMMER DIESEL

Stonehammer Diesel Inc.  
PO Box 1235  
124-1125 North Railway St.  
Okotoks, AB T1S1B3  
Ph: 403-995-1140 ~ Fax: 403-995-1180

## Invoice



Invoice # 19435  
Work Order # 7503  
Service Advisor Micah Blakeley  
Technician Darian Nimeck

Plate AB AE4286  
Description White 2009 Dodge Ram 3500 SLT L6 6.7L  
408CID VIN L  
VIN 3D7MX39L89G511742  
Odometer 317,409  
Invoice Date 6/24/2025 4:43 PM  
Appointment 6/24/2025 8:00 AM  
Promised 6/24/2025 5:00 PM

### Service

**Rear Differential Service- REPORT IF REAR DIFF HAS RE-USEABLE GASKET OR SILICONE IS REQUIRED- CUST WILL BE TOWING A TRAILER THROUGH THE MOUNTAIN**

Labor	1 Hour		\$145.00 *G
10123 - LUCAS SYN GEAR OIL 75W140	3 Litre	\$23.66 / Litre	\$70.98 G
	<b>Sub</b>		<b>\$215.98</b>

#### TECH NOTES

SERVICED REAR DIFF AS REQUIRED WITH SYN 75W140 OIL. **VISUAL INSPECTION:** The front diff oil is very dark in colour. The t-case oil is very dark in colour. One of the exhaust hangers is broken off - removed as needed. The rear diff pinion seal is minor sweat and the front diff pinion seal is leaking badly. The rear shocks are old and rusty. There is a slight oil leak coming from the front cover area and pan - cleaned off as required. There is very minor play in the Tie rod end @ pitman arm.

#### Transfer Case Service

Labor	0.5 Hour		\$72.50 *G
00678-06 - CASTROL TRANSMAX SYN MULTI VEHICLE ATF	6 Litre	\$14.99 / Litre	\$89.94 G
	<b>Sub</b>		<b>\$162.44</b>

#### TECH NOTES

#### Differential Pinion Seal - Front

Labor	2.4 Hour		\$348.00 *G
05086697-AB - Differential Pinion Seal - Front	1 Unit	\$90.70 / Unit	\$90.70 G
05086696-AC - Differential Yoke- Front	1 Unit	\$420.66 / Unit	\$420.66 G
	<b>Sub</b>		<b>\$859.36</b>

#### TECH NOTES

R/R FRONT PINION SEAL AND FOUND THE YOLK HAS MULTIPLE DEEP RIDGES AND WILL REPLACE ALSO,

#### Front Differential Service

Labor	1 Hour		\$145.00 *G
10072 - LUCAS SYN 75W-90 GEAR OIL	3 Litre	\$19.99 / Litre	\$59.97 G
	<b>Sub</b>		<b>\$204.97</b>

#### TECH NOTES

COMPLETED DIFF SERVICE

Total Parts		\$732.25
Total Labor		\$710.50
Total Before Taxes & Miscellaneous Charges		\$1,442.75
(*) Shop supplies	7 %	\$49.74 G
(G) Canadian Goods and Services Tax (GST)	5 %	\$74.62
<b>Grand Total</b>		<b>\$1,567.11</b>

GST#738771120

Stonehammer Diesel Inc. does not take any responsibility for the customer or customers vehicle due to any modifications or plus sizing of wheels and or tires. Original copy of the invoice is required for returns, exchanges, credits and warranty work. Stonehammer Diesel Inc. will not be held liable for the loss or damage to your vehicle or articles left in the vehicle due to fire, theft, accident or any other cause beyond our control. All cancellations or returns will be subject to a 30% restocking fee. Any deposits given are NON returnable. Customer provided parts will NOT be warrantied and install will not NOT be warrantied by Stonehammer Diesel Inc. Any and all charges must be paid before the release of the vehicle, Stonehammer Diesel Inc. has the right to hold the vehicle until the charges are paid in full. **RE-TORQUE WHEELS AFTER 100KM**

**Customer Signature:** \_\_\_\_\_

**Authorization(s)**

6/23/2025 9:07 AM      \$237.44



---

GST#738771120



403 (230) 2886

info@monzaauto.com

3620 3a St NE, Calgary, Calgary, AB, Canada, T2E 6R4



Invoice # 80971

Against Estimate#: 14337

Created: May 10, 2024

Invoiced: May 21, 2024

2009 Dodge Ram 3500 Laramie

VIN: 3D7MX39L89G511742

Mileage: 277836 km

License Plate:

**Lab/Steering****Authorized**

ItemName	Description	Price	QTY/HRS	Amount
1 Lab Steering	Replaced right outer drag link end due to part worn and has play. Found no further issues at this time.	\$149.95	1	\$149.95
2 4WA	4-Wheel Alignment	\$149.95	1	\$149.95
3 DI81032	Drag link bar	\$119.68	1	\$119.68

Service subtotal: \$419.58

**Driveline****Authorized**

ItemName	Description	Price	QTY/HRS	Amount
1 Lab Driveline	Replace left front cv axle u-joint due to part worn and has excessive play. Found no further issues at this time.	\$149.95	2	\$299.90
2 363	CV Axle U-joint	\$133.17	1	\$133.17

Service subtotal: \$433.07

Thank you for your business. The work is complete and your payment is due upon pickup of the vehicle. Mechanics liens may be placed on vehicles until repairs are paid for in full. Please contact us promptly if you have any questions about anything we did.  
GST# 884757501RT0001

<b>Service Amount</b>	<b>\$852.65</b>
Part	\$252.85
Labor	\$599.80
Total RO Fees	
Shop supplies	\$50.00
<b>Subtotal</b>	<b>\$902.65</b>
<b>Passthrough Taxes</b>	<b>\$0.00</b>
Taxes (Sales Tax - 5%)	\$45.14
<b>Grand total</b>	<b>\$947.79</b>
<b>Paid to date</b>	<b>\$0.00</b>
<b>Remaining balance</b>	<b>\$947.79</b>

Signature: \_\_\_\_\_



# Paragon Motors

1-1693 Cary Rd  
Kelowna, BC. V1X 2C1

Phone: 250-762-6006

\*\*\*HELPING TO PUT YOUR MIND AT REST\*\*\*

## INVOICE

55003

Org. Est. # 089256

120141916 GST

1014-5293 PST#

## INVOICE

Printed Date: 07/19/2023

Work Completed: 07/19/2023

2009 Dodge - Pickup R3500 - 6.7L, In-Line6 (408CI) VIN(L)

Lic # :

Odometer In : 263419

VIN # : 3D7MX39L8 9G511742

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
OIL SEAL 710564	2.00	106.28	212.56	Customer believes diff fluid is leaking in the rear	
BRK PAD SET PGD1400M	1.00	183.99	183.99	FOUND UPON INSPECTION & SERVICES PERFORMED:	
PARKING BRAK 854PG	1.00	139.99	139.99	- Power Steering pump is leaking	
PARKING BRAKE HARDWARE KIT H7334	1.00	70.25	70.25	- Left front axle seal is leaking	
DIFFERENTIAL GASKET RDS 55473	1.00	133.48	133.48	- Right front axle seal is leaking	
Gear Oil 75w90 Synthetic 75-90	3.60	27.13	97.67	- Right rear brake is soaked is fluid	
Multi-Fluid Diff/Transfer Case Cleaner 206235	1.00	41.99	41.99	- Right front wheel bearing needs replacing	
Shop Supplies			40.75	confirm diff fluid leaking	n/c
				Symptoms: customer believe diff fluid is leaking from the rear	
				WHEEL SEAL - Remove & Replace - R2500,R3500	406.00
				Both Sides,w/Full Floating Rear Axles	
				DIFFERENTIAL FLUID - Drain & Refill - R2500,R3500	72.50
				Full Floating Rear Axle	26.40

### Taxes

GST	71.28
PST	99.79

Org. Estimate 170.63 Revisions 0.00 Current Estimate 170.63

Labor:	478.50
Parts:	920.68
HazMat:	26.40
SubTotal:	1,425.58
Tax:	171.07
Total:	1,596.65
Bal Due:	\$0.00

Customer Number : 13460

th / 24,000 KM warranty against defects in parts or

Signature

Date

Visit us on the web: [www.paragonmotors.ca](http://www.paragonmotors.ca)

Email Address: [service@paragonmotors.ca](mailto:service@paragonmotors.ca)

Service Advisor : Dave, H., Tech : 1 Drew, H; 4 Harry, Dunn

Yozzy's Used Truck Parts Ltd.  
354234 - 176th Street East  
High River AB T1V 1N3  
4039985034  
yozzys@icloud.com  
GST/HST Registration No.:  
778679290RC0001



## SALES RECEIPT

**SALES # 5191**  
**DATE 30-05-2025**

**PMT METHOD**  
**E-TRANSFER**

ACTIVITY	QTY	RATE	AMOUNT	TAX
<b>Sales</b>	1	2,652.00	2,652.00	GST
2008 6.7l cummins ecm				

GST @ 5% 126.29  
TOTAL 2,652.00  
BALANCE DUE **\$0.00**

### TAX SUMMARY

RATE	TAX	NET
GST @ 5%	126.29	2,525.71



Stonehammer Diesel Inc.  
PO Box 1235  
124-1125 North Railway St.  
Okotoks, AB T1S1B3  
Ph: 403-995-1140 ~ Fax: 403-995-1180

## Authorization



Work Order # 6328  
Service Advisor Micah Blakeley  
Technician Steven Boutilier -1

Plate AB AE4286  
Description White 2009 Dodge Ram 3500 SLT L6 6.7L  
408CID VIN L  
VIN 3D7MX39L89G511742  
Odometer 305,201  
Appointment 1/27/2025 8:00 AM  
Promised 1/27/2025 9:00 AM

## Concern

Note(s) NEEDS VEHICLE BACK BY END OF DAY

## Service

### Lube, Oil & Filter Service - Synthetic Oil - Diesel

Labor	0.5 Hour		\$30.00 *G
04154 - ROYAL PURPLE 15W-40 SYNTHETIC 1 LITER	11 Litre	\$15.26 / Litre	\$167.88 EG
BT7349 - Dodge Light-Duty Trucks with 5.9L and 6.7L Turbo Diesel-Engine Oil Filter	1 Unit	\$29.99 / Unit	\$29.99 EG
		Sub	\$227.87

### TECH NOTES

changed oil and filter used 15w-40 syn royal purple. topped up washer fluid.

### Turbocharger

Labor	4.5 Hour		\$652.50 *G
5325950HX - Turbocharger Holset Reman Turbo	1 Unit	\$3,675.00 / Unit	\$3,675.00 G
HGK016 - Turbo Install Kit	1 Unit	\$90.91 / Unit	\$90.91 G
		Sub	\$4,418.41

### TECH NOTES

drained coolant from vehicle removed air box assembly passenger side inner fender liner and hot side cac tube. removed and replaced turbo with new gaskets and o-rings. installed hot side cac tube, passenger side inner fender liner and installed new s&b cold air intake. filled cooling system with coolant saved from vehicle topped up coolant with all makes coolant. cleared codes then ran vehicle noticed ebp tube is cracked. road vehicle then scanned for codes no codes found at this time topped up coolant to full mark on bottle.

### S&B Cold Air Intake - NO LABOUR CHARGE IF INSTALLED WITH TURBOCHARGER

Labor	0 Hour		\$0.00 *G
SAB75-5093 - S&B COLD AIR INTAKE RAM 07-09 6.7L Cummins	1 Unit	\$475.99 / Unit	\$475.99 G
WF-1023 - S&B Filter Wrap	1 Unit	\$49.99 / Unit	\$49.99 G
		Sub	\$525.98

### TECH NOTES

installed s&b cold ai intake with filter wrap

### Battery Terminal

Labor	0.3 Hour		\$43.50 *G
82-9124 - BATTERY TERMINAL POSITIVE BRASS- 5/16" STUD	1 Unit	\$10.46 / Unit	\$10.46 G
		Sub	\$53.96

### TECH NOTES

removed and replaced passenger side positive battery terminal.

### EBP Sensor Tube - CUSTOMER TO RETURN FOR INSTALL OF EBP TUBE

Labor	0 Hour		\$0.00 *G
68038087-AA - EBP Sensor Tube- ORDERED PART OEM OVERNIGHT RED DEER	1 Unit	\$195.46 / Unit	\$195.46 G
		Sub	\$195.46

## TECH NOTES

Total Parts		\$4,695.68
Total Labor		\$726.00
Total Before Taxes & Miscellaneous Charges		\$5,421.68
(*) Shop supplies	7 %	\$50.82 G
(E) Environmental Disposal	\$0.55 Each	\$6.60 G
(G) Canadian Goods and Services Tax (GST)	5 %	\$273.96
Grand Total		\$5,753.06
Total Deposit & Payment		\$500.00
Total Outstanding		\$5,253.06

Stonehammer Diesel Inc. does not take any responsibility for the customer or customers vehicle due to any modifications or plus sizing of wheels and or tires. Original copy of the invoice is required for returns, exchanges, credits and warranty work. Stonehammer Diesel Inc. will not be held liable for the loss or damage to your vehicle or articles left in the vehicle due to fire, theft, accident or any other cause beyond our control. All cancellations or returns will be subject to a 30% restocking fee. Any deposits given are NON returnable. Customer provided parts will NOT be warrantied and install will not NOT be warrantied by Stonehammer Diesel Inc. Any and all charges must be paid before the release of the vehicle, Stonehammer Diesel Inc. has the right to hold the vehicle until the charges are paid in full. Re-torque wheels after 100km.

**Customer Signature:** \_\_\_\_\_

**Authorization(s)**

1/8/2025 12:12 PM \$5,487.97


In Person / Other





Stonehammer Diesel Inc.  
PO Box 1235  
124-1125 North Railway St.  
Okotoks, AB T1S1B3  
Ph: 403-995-1140 ~ Fax: 403-995-1180

## Deposit Receipt

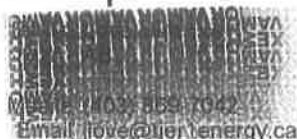

Work Order # 6328

Plate AB AE4286  
Description White 2009 Dodge Ram 3500 SLT L6 6.7L  
408CID VIN L  
VIN 3D7MX39L89G511742  
Odometer 305,201  
Appointment 1/27/2025 8:00 AM  
Promised 1/27/2025 9:00 AM

Deposit Date	Description	Method	Deposit Amount
1/27/2025 4:39 PM	FULL AMOUNT DEPOSIT	Visa	\$5,253.06

Stonehammer Diesel Inc. does not take any responsibility for the customer or customers vehicle due to any modifications or plus sizing of wheels and or tires. Original copy of the invoice is required for returns, exchanges, credits and warranty work. Stonehammer Diesel Inc. will not be held liable for the loss or damage to your vehicle or articles left in the vehicle due to fire, theft, accident or any other cause beyond our control. All cancellations or returns will be subject to a 30% restocking fee. Any deposits given are NON returnable. Customer provided parts will NOT be warrantied and install will not NOT be warrantied by Stonehammer Diesel Inc. Any and all charges must be paid before the release of the vehicle, Stonehammer Diesel Inc. has the right to hold the vehicle until the charges are paid in full. Re-torque wheels after 100km.

Customer Signature: \_\_\_\_\_

### DID WE DO A GOOD JOB TODAY?

Your Feedback is really important to us. consider leaving us some feedback about your experience here at Stonehammer Diesel. Leave us a review, like and follow us on Facebook and Instagram

1/27/2025 4:40 PM

Work Order #6328


Page 1 of 1





Stonehammer Diesel Inc.  
PO Box 1235  
124-1125 North Railway St.  
Okotoks, AB T1S1B3  
Ph: 403-995-1140 ~ Fax: 403-995-1180

## Invoice

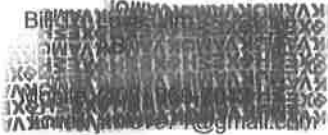

Invoice # 19384  
Work Order # 7385  
Service Advisor Micah Blakeley  
Technician Steven Boutilier -1

Plate AB AE4286  
Description White 2009 Dodge Ram 3500 SLT L6 6.7L  
408CID VIN L  
VIN 3D7MX39L89G511742  
Odometer 316,940  
Invoice Date 6/17/2025 11:07 AM  
Appointment 6/16/2025 4:00 PM  
Promised 6/16/2025 5:00 PM

### Concern

**Note(s) FACTORY PROGRAMMING MAY REQUIRE KEYS TO BE PROGRAMMED- HAVE CUSTOMER SUPPLY ALL WORKING CHIPPED KEYS**

### Service

#### Install Customer Supplied Pcm/Ecu- USED PART

Labor	1.5 Hours		\$247.50 *G
REPROGRAM - SUBLET - DEALER PCM/TCM	1 Unit	\$200.00 / Unit	\$200.00 G
REPROGRAMMING			
		<b>Sub</b>	<b>\$447.50</b>

#### TECH NOTES

INSTALLED CUSTOMER SUPPLIED ECM, HAD DEALER REPROGRAM ECM/TCM. CLEARED CODES THEN RAN VEHICLE CHECK ENGINE LIGHT IS NOT SET. SCANNED FOR CODES NO CODES FOUND AT THIS TIME. USED SCAN TOOL TO MONITOR VGT ACTUAL AND DESIRED POSITION CONFIRM THEY ARE READING THE SAME. TEST EXHAUST BRAKE CONFIRM ITS WORKING AS IT SHOULD.

#### Custom Tuning

67C-EFI-SOTF-VIN - AMDP 2007.5-2009 6.7L Cummins	1 Unit	\$975.00 / Unit	\$975.00 G
EFI Live Custom Tuning 5 Position SOTF Tune Package- Includes VIN Licence			
Labor	1 Hour		\$145.00 *G
		<b>Sub</b>	<b>\$1,120.00</b>

#### TECH NOTES

INSTALLED CUSTOM SOTF 5 POSITION TUNE WITH EFI LIVE. ROAD TEST VEHICLE IN ALL 5 POSITIONS CONFIRM EVERYTHING IS WORKING AS IT SHOULD. LEVEL 1- 0HP EMISSIONS OFF, LEVEL 2- 50HP, LEVEL 3-75HP, LEVEL 4- 100 HP, LEVEL 5- 150HP. IT IS NOT RECOMMENDED TO TOW ON LEVEL 4 OR 5 AND SUGGEST MONITOR EGT ON 4 & 5.

#### Automatic Transmission Fluid & Filter Service

Labor	2 Hour		\$290.00 *G
20000 - Transmission Filter Kit 68RFE	1 Unit	\$136.54 / Unit	\$136.54 G
00678-06 - CASTROL TRANSMAX SYN MULTI VEHICLE	13 Litre	\$14.99 / Litre	\$194.87 G
ATF 208L Drum			
		<b>Sub</b>	<b>\$621.41</b>

#### TECH NOTES

DRAINED FLUID FROM TRANSMISSION. REMOVED OIL PAN THEN REMOVED AND REPLACED BOTH TRANSMISSION FILTERS . INSTALLED TRANSMISSION PAN, FILLED TRANSMISSION WITH TRANS MAX SYN ATF. ROAD TEST VEHICLE TO OPERATING TEMP FILLED TRANSMISSION TO FULL MARK ON DIPSTICK.

Total Parts	\$1,506.41
Total Labor	\$682.50
Total Before Taxes & Miscellaneous Charges	\$2,188.91

GST#738771120

www.stonehammerdiesel.ca

6/17/2025 11:08 AM

Invoice #19384

Page 1 of 2

(\*) Shop supplies  
(G) Canadian Goods and Services Tax (GST)  
**Grand Total**

7 %	\$47.78 G
5 %	\$111.83
	<hr/>
	<b>\$2,348.52</b>

PAID  
6/9/2025 1:48 PM \$2,348.52 by Visa

Stonehammer Diesel Inc. does not take any responsibility for the customer or customers vehicle due to any modifications or plus sizing of wheels and or tires. Original copy of the invoice is required for returns, exchanges, credits and warranty work. Stonehammer Diesel Inc. will not be held liable for the loss or damage to your vehicle or articles left in the vehicle due to fire, theft, accident or any other cause beyond our control. All cancellations or returns will be subject to a 30% restocking fee. Any deposits given are NON returnable. Customer provided parts will NOT be warrantied and install will not NOT be warrantied by Stonehammer Diesel Inc. Any and all charges must be paid before the release of the vehicle, Stonehammer Diesel Inc. has the right to hold the vehicle until the charges are paid in full.

**RE-TORQUE WHEELS AFTER 100KM**

**Customer Signature:** \_\_\_\_\_

**Authorization(s)**

6/9/2025 1:48 PM      \$1,674.73

In Person / Other



---

GST#738771120

# KELOWNA TRANSMISSION & AUTO REPAIR

#4-455 Neave Ct.  
Kelowna, B.C. V1V-2M2  
Phone: 250-765-7505 Fax: 250-765-7505  
WE ARE MORE THAN JUST TRANSMISSIONS!!

INVOICE

15741

## INVOICE

Date: 07/02/2021

2009 Dodge - Pickup R3500 - 6.7L, In-Line6 (408CI) VIN(L)

Lic # :

Odometer In : 0

Odometer Out : 228395

VIN # :

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
LINE PRESSURE SENSOR 29878	1.00	225.95	225.95	WENT INTO LIMP MODE PULLING A TRAILER P0700 P0740. CHECK AND ADVISE	n/c
TCC VALVE KIT 44912-03K	1.00	161.23	161.23	CHECKED FOR CODES AND FOUND P2267 WATER IN FUEL SENSOR CIRCUIT HIGH P0218 TRANS HIGH TEMP OPERATION ACTIVE.	
H.D BILLET TORQUE CONVERTER 68-5BC	1.00	1,295.00	1,295.00	CLEARED CODES AND ROAD TESTED FOUND TORQUE CONVERTER LOCK UP IS IN TRANSITION. MODE WHILE IN FULL LOCK UP STATE. REMOVED THE TRANS PAN AND INSPECTED THE FILTER AND PAN. FOUND LOTS OF LOCK UP CLUTCH MATERIAL INSIDE THE FILTER.	
SHIFT KIT SK45RFE	1.00	165.00	165.00		
EXTREME REBUILD KIT, WITH CUT PLATES, RED EAGLES AND FILTERS 149370	1.00	1,100.00	1,100.00	TEARDOWN AND INSPECT TAKE APART TRANSMISSION AND INSPECT ,FOUND SECOND,FOURTH AND OD CLUTCHES BURNT, OIL WAS COOKED	1,656.00
SOLENOID ASSEMBLY D72420A	1.00	558.10	558.10	REBUILD TRANSMISSION WITH EXTREME REBUILD KIT, UPDATED PLATES, RED EAGLE CLUTCHES ,SECOND AND FOURTH	
SWITCH VALVE KIT 92835-31K	1.00	139.10	139.10	REAM PUMP FOR OVERSIZED TCC SWITCH VALVE AND LIMIT VALVE	
TCC SWITCH VALVE K29883W	1.00	125.55	125.55	REAM VALVE BODY FOR OVER SIZED SWITCH VALVE AND PLUGS	
BONDED SEPERATER PLATE 29995L5	1.00	175.99	175.99	USED BONDED SEPERATER PLATE REPLACE LINE PRESSURE SENSOR RE INSTALL TRANSMISSION, FILL WITH FLUID AND ROAD TEST.	
DODGE ATF +4 ATF+4	16.00	8.60	137.60	SHIPPING	28.85
Shop Supplies			159.99	Hazardous Materials	19.95

### Taxes

GST	297.42
PST	416.38

Org. Estimate 0.00 Revisions 0.00 Current Estimate 0.00

Labor:	1,656.00
Parts:	4,243.51
Sublet:	28.85
HazMat:	19.95
SubTotal:	5,948.31
Tax:	713.80
Total:	6,662.11
Bal Due:	\$6,662.11

Customer Number : 7177

[Paym  
Vehic

An  
KM  
excc  
341:

Sig

KELOWNA TRANSMISSION A  
455 NEAVE CT UNIT 4  
KELOWNA, BC V1V 2M2

Merchant ID: 0000000000533792  
Tel: 250-765-7505  
Fax: 250-765-7505

### Purchase

Visa Credit

XXXXXXXXXXXX2806

AID: A0000000031010

Entry Method: Chip

Batch#: 001072

16:01:44

07/02/21

Ref#:000021702679

Inv N: 005068 Appr Code: 076771

Total: \$ 6,662.11

Customer Copy

Warranty on new or rebuilt parts and labor is one year or 20,000  
Warranty work has to be performed in our shop & cannot  
include towing, lodging or any related expenses. GST# 8755

Email Address: info@kelownatransmission.com