


1997 Class A Diesel Freightliner

Report URL: <https://atxt.me/QXpEJil>

Customer Name	James M	Phone No.	(xxx)-xxx-x967
Submodel		Engine Size	
2WD or 4WD		VIN	4UZ6XJBC1VC777372
License		Mileage	0
ABS		Transmission	
Est/Invoice#	64625	Production Date	
Notes			

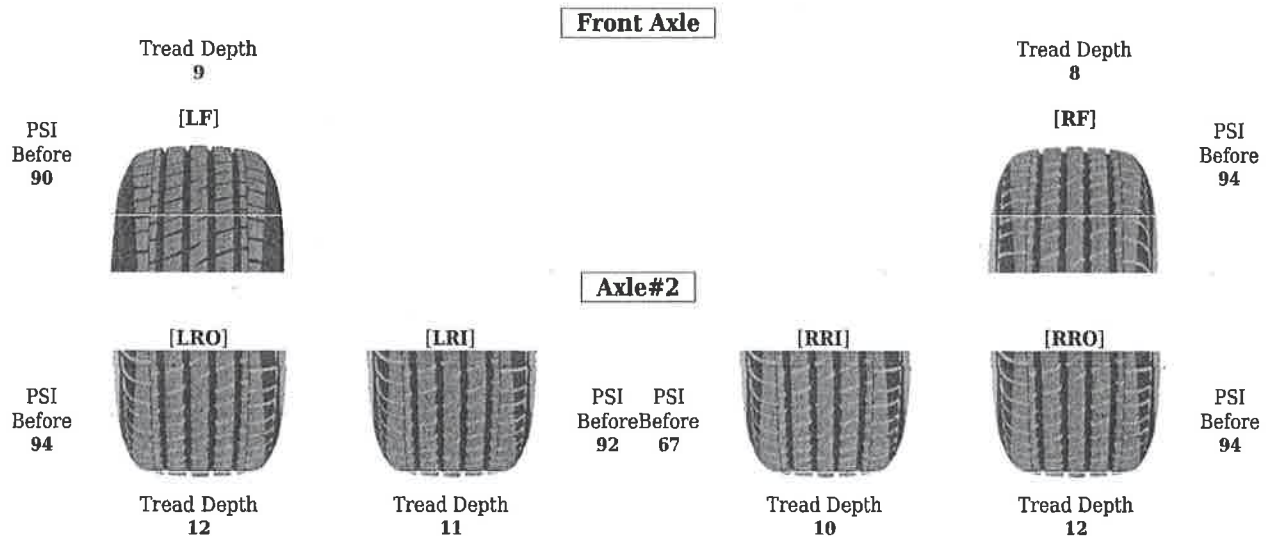

Tire Name	Notes
LF Tire	Cracking in tread
RF Tire	Set to 90 psi

COPY

Level 2 Motorhome Service

✓ 4 Requires Urgent Attention

#	Insp Item	Notes
X	A/C / heat fan operation	Blower not blowing cold air. AC compressor not engaging.

X Exterior light assessment Inoperative lights. Has a front clearance light and a rear clearance light out

X Tire condition assessment LF Tire have cracks in tread. All tires are 2006 or older



X Tech notes Generator exhaust hanger partly broken



✓ 2 Requires Future Attention

Insp Item Notes
! Generator service assessment Air filter ok. Has inline fuel filter not sure when replaced last.



! Fluid leaks Engine oil pan area, transmission input seal, differential carrier. Oil pan is the only one with drips.



COPY


✓ 27 Good Items

Insp Item Notes
✓ Vehicle Damage/ Missing Hubcaps

- ✓ Mirrors
- ✓ Horn operation
- ✓ Wiper / Washers operation
- ✓ Warning lamp on dash
- ✓ Windshield washer fluid
- ✓ Coolant strength & condition -50 Celsius
- ✓ Transmission fluid
- ✓ Battery cables assessment
- ✓ Battery Strip/charging voltage Alternator charging 13.9 volts



- ✓ Battery condition
- ✓ Radiator assessment
- ✓ Radiator hose assessment
- ✓ Air filter assessment Indicator shows ok. Filter doesn't look super old.

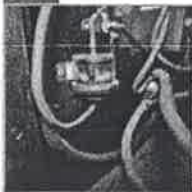








- ✓ Drive belt assessment



- ✓ Tensioner pulley assessment

COPY

<p>✓ Tech notes</p> 	<p>Front hub oil levels good. Fuel filter ? When replaced last.</p>
<p>✓ Wheel bearing assessment</p> <p>✓ Steering linkage / suspension assessment</p> <p>✓ Strut / shock assessment</p> <p>✓ Visual front brake assessment</p>	
 	
<p>✓ Visual rear brake assessment</p>  	
<p>✓ Brake component visual assessment</p>  	<p>All brakes have auto slack adjusters. Checked pushrod lengths and were good</p>
<p>✓ Driveline and axles assessment</p> <p>✓ Rear differential fluid assessment</p> <p>✓ Exhaust system visual assessment</p> <p>✓ Suspension assessment</p>	<p>Condition Good</p>

Copy

This report was signed off on 05/22/2024 04:01 pm

Technician: Admin User

COPY